



Belt Replacement Instructions




1x Phillips Screw Driver

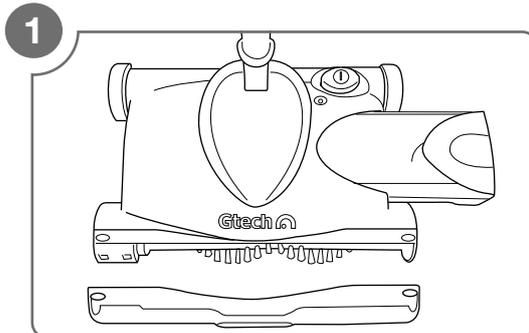


1 Remove the visor, dust tray and tubes from the main body of the sweeper.

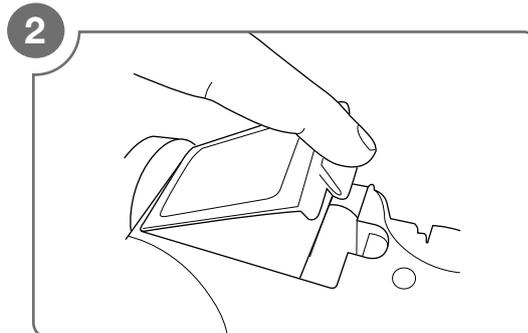


2 Turn the sweeper upside down and open the battery compartment.

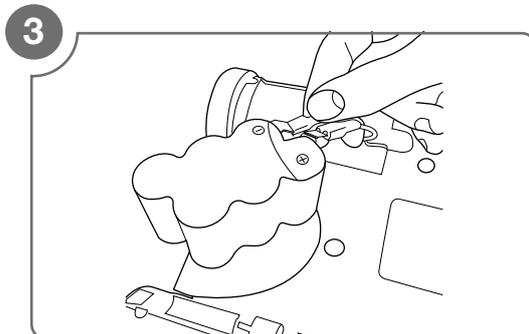


3 Lift out the battery pack. Straighten up the connectors so you can handle them more easily.

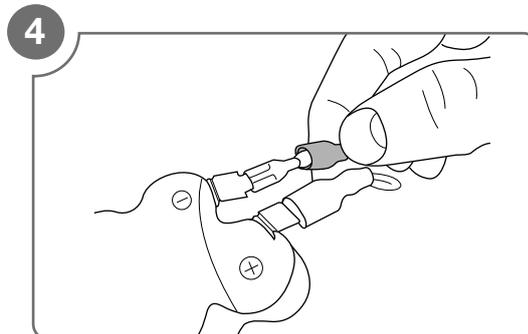


4 Starting with the **BLACK** wire, pull back the plastic cover from the connector.

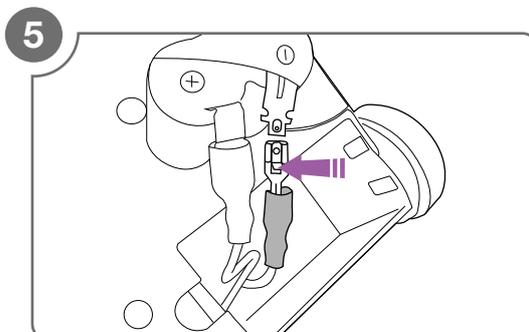


5 To disconnect the wire from the battery press the catch and pull the connector away from the terminal.

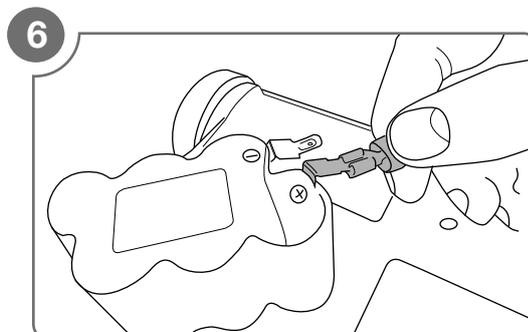


6 Repeat steps 4 and 5 for the **RED** wire.

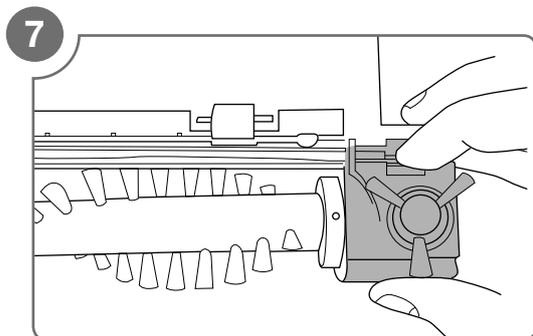


7 Remove the edge wheel

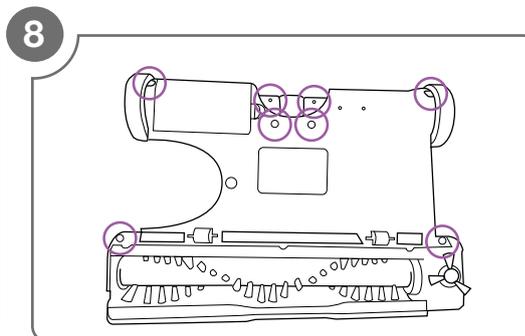


8 Unscrew all 8 screws, as marked on the illustration.

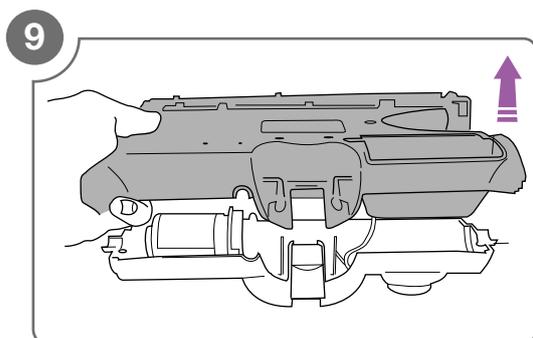


9 Lift off the bottom housing. This will free the handle.

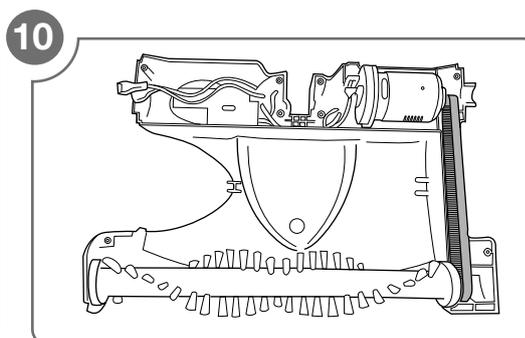


10 You will now be able to see the belt.

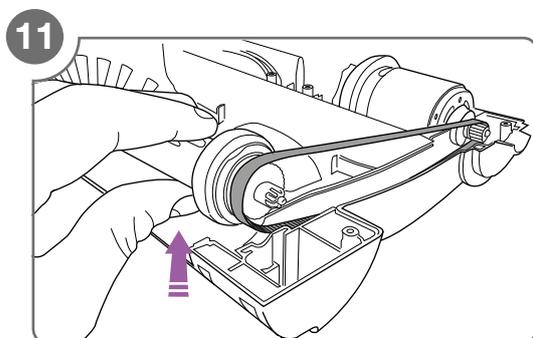


11 To remove the belt, lift the brush bar and slide the belt off the gear.

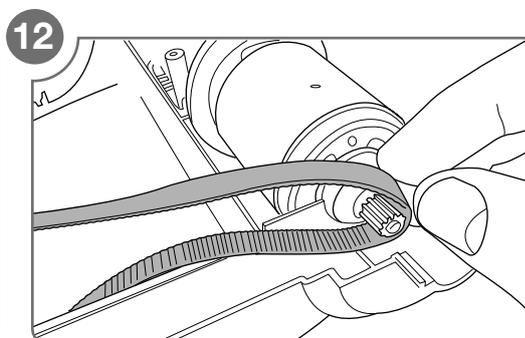


12 Attach the new belt onto the motor first and then onto the brush bar gear. Once the belt has been fitted, replace the bottom housing.

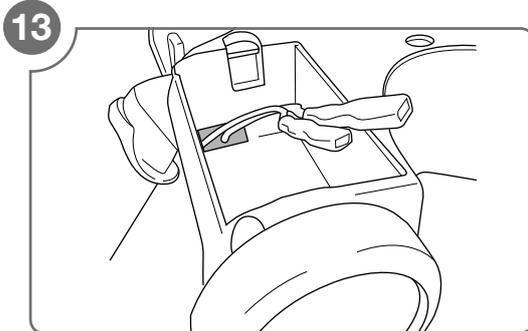


13 Ensure that the wires connecting to the battery are fed back through into the battery compartment before sealing the unit. Also ensure the handle is in place.

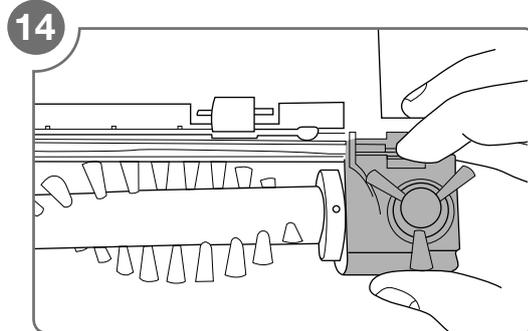


14 Replace the edge wheel

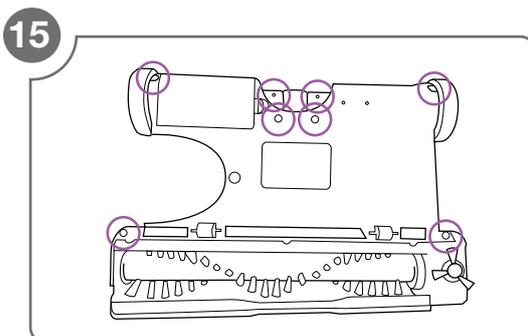


15 Replace the 8 screws, making sure all the sides are level and sealed.

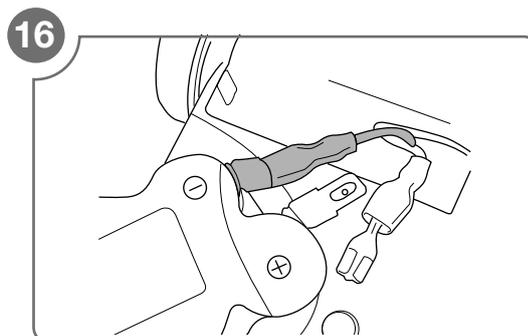


16 Re-attach the wires to the battery, attaching the **BLACK** wire first. Fold the terminals back along the battery.

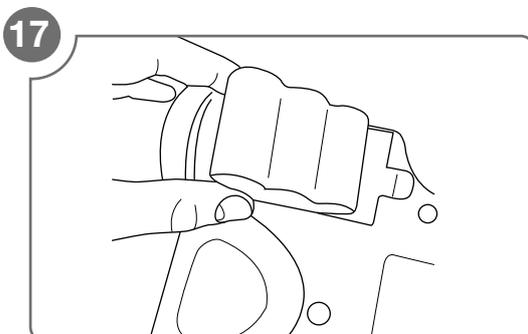


17 Put the battery back into the compartment and replace the cover.

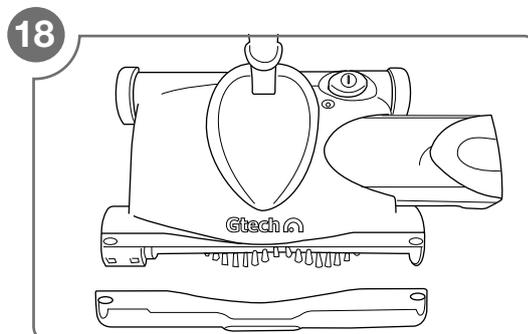

18 Replace the visor, dust tray and tubes.

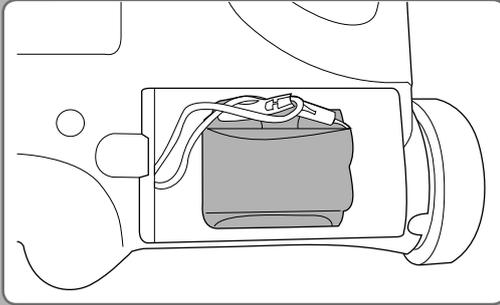

The SW26 has a smaller battery but with similar connectors.

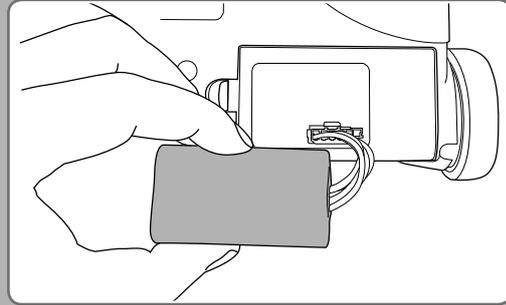

The Lithium ion battery for the SW22 has a five-pin connector that clips into the sweeper.

Need more help? Call the Gtech Customer Service Center on 01905 345 891